



***Federal Railroad Administration
Office of Safety
Headquarters Assigned
Accident Investigation Report
HQ-2008-30***

***Amtrak (ATK)
Windsor Locks, CT
March 17, 2008***

Note that 49 U.S.C. §20903 provides that no part of an accident or incident report made by the Secretary of Transportation/Federal Railroad Administration under 49 U.S.C. §20902 may be used in a civil action for damages resulting from a matter mentioned in the report.

1. Name of Railroad Operating Train #1 Amtrak [ATK]		1a. Alphabetic Code ATK		1b. Railroad Accident/Incident No. 107436		
2. Name of Railroad Operating Train #2 N/A		2a. Alphabetic Code N/A		2b. Railroad Accident/Incident No. N/A		
3. Name of Railroad Operating Train #3 N/A		3a. Alphabetic Code N/A		3b. Railroad Accident/Incident No. N/A		
4. Name of Railroad Responsible for Track Maintenance: Amtrak [ATK]		4a. Alphabetic Code ATK		4b. Railroad Accident/Incident No. 107436		
5. U.S. DOT_AAR Grade Crossing Identification Number		6. Date of Accident/Incident Month 03 Day 17 Year 2008		7. Time of Accident/Incident 09:56:00 <input checked="" type="checkbox"/> AM <input type="checkbox"/> PM		
8. Type of Accident/Incident (single entry in code box)						
1. Derailment		4. Side collision		7. Hwy-rail crossing		
2. Head on collision		5. Raking collision		10. Explosion-detonation		
3. Rear end collision		6. Broken Train collision		11. Fire/violent rupture		
		9. Obstruction		12. Other impacts		
				13. Other (describe in narrative) Code 01		
9. Cars Carrying HAZMAT 0		10. HAZMAT Cars Damaged/Derailed N/A		11. Cars Releasing HAZMAT N/A		
				12. People Evacuated 0		
				13. Division Northeast		
14. Nearest City/Town Windsor Locks		15. Milepost (to nearest tenth) 49.3		16. State Abbr Code N/A CT		
				17. County HARTFORD		
18. Temperature (F) (specify if minus) 40 F		19. Visibility (single entry) Code 1. Dawn 3. Dusk 2. Day 4. Dark 2		20. Weather (single entry) Code 1. Clear 3. Rain 5. Sleet 2. Cloudy 4. Fog 6. Snow 1		
				21. Type of Track Code 1. Main 3. Siding 2. Yard 4. Industry 1		
22. Track Name/Number Single Main		23. FRA Track Code Class (1-9, X) 4		24. Annual Track Density (gross tons in millions) N/A		
				25. Time Table Direction Code 1. North 3. East 2. South 4. West 1		
OPERATING TRAIN #1						
26. Type of Equipment Consist (single entry)		1. Freight train		4. Work train		
2. Passenger train		5. Single car		7. Yard/switching		
3. Commuter train		6. Cut of cars		A. Spec. MoW Equip. Code		
		9. Maint./inspect.car		27. Was Equipment Attended? Code 1. Yes 2. No 1		
29. Speed (recorded speed, if available) Code R - Recorded E - Estimated 31 MPH R		31. Method(s) of Operation (enter code(s) that apply) a. ATCS g. Automatic block m. Special instructions b. Auto train control h. Current of traffic n. Other than main track c. Auto train stop i. Time table/train orders o. Positive train control d. Cab j. Track warrant control p. Other (Specify in narrative) Code(s) e. Traffic k. Direct traffic control f. Interlocking l. Yard limits			31a. Remotely Controlled Locomotive? 0 = Not a remotely controlled 1 = Remote control portable 2 = Remote control tower 3 = Remote control transmitter - more than one remote control transmitter 0	
30. Trailing Tons (gross tonnage, excluding power units) N/A		d e f g N/A				
32. Principal Car/Unit		a. Initial and Number		b. Position in Train		
(1) First involved (derailed, struck, etc)		AMT 106		1		
(2) Causing (if mechanical cause reported)		0		0		
				c. Loaded (yes/no) N/A		
				33. If railroad employee(s) tested for drug/alcohol use, enter the number that were positive in the appropriate box. Alcohol Drugs N/A N/A		
				34. Was this consist transporting passengers? (Y/N) Y		
35. Locomotive Units		a. Head End		Mid Train		
		b. Manual		c. Remote		
		d. Manual		c. Remote		
(1) Total in Train		1		0 0		
(2) Total Derailed		1		0 0		
				36. Cars		
				a. Freight b. Pass. c. Freight d. Pass. e. Caboose		
				(1) Total in Equipment Consist 0 2 0 0 0		
				(2) Total Derailed 0 0 0 0 0		
37. Equipment Damage		38. Track, Signal, Way, & Structure Damage		39. Primary Cause Code		
This Consist \$47,021.00		\$0.00		M101		
				40. Contributing Cause Code N/A		
Number of Crew Members				Length of Time on Duty		
41. Engineer/Operators 1		42. Firemen 0		43. Conductors 1		
				44. Brakemen 1		
				45. Engineer/Operator Hrs 4 Mi 57		
				46. Conductor Hrs 4 Mi 57		
Casualties to:		47. Railroad Employees		48. Train Passengers		
Fatal		0		0		
Nonfatal		0		0		
				49. Other 0		
				50. EOT Device? 1. Yes 2. No N/A		
				51. Was EOT Device Properly Armed? 1. Yes 2. No N/A		
				52. Caboose Occupied by Crew? 1. Yes 2. No N/A		
OPERATING TRAIN #2						
53. Type of Equipment Consist (single entry)		1. Freight train		4. Work train		
2. Passenger train		5. Single car		7. Yard/switching		
3. Commuter train		6. Cut of cars		A. Spec. MoW Equip. Code		
		9. Maint./inspect.car		54. Was Equipment Attended? Code 1. Yes 2. No N/A		
56. Speed (recorded speed, if available) Code R - Recorded E - Estimated 0 MPH N/A		58. Method(s) of Operation (enter code(s) that apply) a. ATCS g. Automatic block m. Special instructions b. Auto train control h. Current of traffic n. Other than main track			58a. Remotely Controlled Locomotive? 0 = Not a remotely controlled 1 = Remote control portable	

57. Trailing Tons (gross tonnage, excluding power units)	N/A	c. Auto train stop d. Cab e. Traffic f. Interlocking	i. Time table/train orders j. Track warrant control k. Direct traffic control l. Yard limits	o. Positive train control p. Other (Specify in narrative) Code(s)	2 = Remote control tower 3 = Remote control transmitter - more than one remote control transmitter
				N/A N/A N/A N/A N/A	N/A

59. Principal Car/Unit	a. Initial and Number	b. Position in Train	c. Loaded(yes/no)	60. If railroad employee(s) tested for drug/alcohol use, enter the number that were positive in the appropriate box.	Alcohol N/A	Drugs N/A
(1) First involved (derailed, struck, etc)	0	0	N/A			
(2) Causing (if mechanical cause reported)	0	0	N/A	61. Was this consist transporting passengers? (Y/N)		N/A

62. Locomotive Units	a. Head End	Mid Train b. Manual c. Remote	Rear End d. Manual c. Remote	63. Cars	Loaded a. Freight b. Pass.	Empty c. Freight d. Pass.	e. Caboose
(1) Total in Train	0	0 0	0 0	(1) Total in Equipment Consist	0 0	0 0	0
(2) Total Derailed	0	0 0	0 0	(2) Total Derailed	0 0	0 0	0

64. Equipment Damage This Consist	\$0.00	65. Track, Signal, Way, & Structure Damage	\$0.00	66. Primary Cause Code	N/A	67. Contributing Cause Code	N/A
Number of Crew Members				Length of Time on Duty			

68. Engineer/Operators	0	69. Firemen	0	70. Conductors	0	71. Brakemen	0	72. Engineer/Operator	Hrs 0 Mi 0	73. Conductor	Hrs 0 Mi 0
------------------------	---	-------------	---	----------------	---	--------------	---	-----------------------	------------	---------------	------------

Casualties to:	74. Railroad Employees	75. Train Passengers	76. Other	77. EOT Device?	1. Yes 2. No N/A	78. Was EOT Device Properly Armed?	1. Yes 2. No N/A
Fatal	0	0	0				
Nonfatal	0	0	0	79. Caboose Occupied by Crew?	1. Yes 2. No		N/A

OPERATING TRAIN #3

80. Type of Equipment Consist (single entry)	1. Freight train	4. Work train	7. Yard/switching	A. Spec. MoW Equip.	Code	81. Was Equipment Attended?	Code	82. Train Number/Symbol
	2. Passenger train	5. Single car	8. Light loco(s).		N/A	1. Yes 2. No	N/A	N/A
	3. Commuter train	6. Cut of cars	9. Maint./inspect.car					

83. Speed (recorded speed, if available)	Code	85. Method(s) of Operation (enter code(s) that apply)	85a. Remotely Controlled Locomotive?
R - Recorded		a. ATCS	0 = Not a remotely controlled
E - Estimated	N/A MPH 0	b. Auto train control	1 = Remote control portable
84. Trailing Tons (gross tonnage, excluding power units)	N/A	c. Auto train stop	2 = Remote control tower
		d. Cab	3 = Remote control transmitter - more than one remote control transmitter
		e. Traffic	
		f. Interlocking	
		g. Automatic block	
		h. Current of traffic	
		i. Time table/train orders	
		j. Track warrant control	
		k. Direct traffic control	
		l. Yard limits	
		o. Positive train control	
		p. Other (Specify in narrative)	
		Code(s)	
		N/A N/A N/A N/A N/A	

86. Principal Car/Unit	a. Initial and Number	b. Position in Train	c. Loaded(yes/no)	87. If railroad employee(s) tested for drug/alcohol use, enter the number that were positive in the appropriate box.	Alcohol N/A	Drugs N/A
(1) First involved (derailed, struck, etc)	0	0	N/A			
(2) Causing (if mechanical cause reported)	0	0	N/A	88. Was this consist transporting passengers? (Y/N)		N/A

89. Locomotive Units	a. Head End	Mid Train b. Manual c. Remote	Rear End d. Manual c. Remote	90. Cars	Loaded a. Freight b. Pass.	Empty c. Freight d. Pass.	e. Caboose
(1) Total in Train	0	0 0	0 0	(1) Total in Equipment Consist	0 0	0 0	0
(2) Total Derailed	0	0 0	0 0	(2) Total Derailed	0 0	0 0	0

91. Equipment Damage This Consist	\$0.00	92. Track, Signal, Way, & Structure Damage	\$0.00	93. Primary Cause Code	N/A	94. Contributing Cause Code	N/A
Number of Crew Members				Length of Time on Duty			


95. Engineer/Operators	0	96. Firemen	0	97. Conductors	0	98. Brakemen	0	99. Engineer/Operator	Hrs 0 Mi 0	100. Conductor	Hrs 0 Mi 0
------------------------	---	-------------	---	----------------	---	--------------	---	-----------------------	------------	----------------	------------

Casualties to:	101. Railroad Employees	102. Train	103. Other	104. EOT	1. Yes 2. No N/A	105. Was EOT Device Properly	1. Yes 2. No N/A
Fatal	0	0	0				
Nonfatal	0	0	0	106. Caboose Occupied by Crew?	1. Yes 2. No		N/A

Highway User Involved				Rail Equipment Involved			
107. C. Truck-Trailer	F. Bus	J. Other Motor Vehicle	Code	111. Equipment	3. Train (standing)	6. Light Loco(s) (moving)	Code
A. Auto	D. Pick-Up Truck	G. School Bus	K. Pedestrian	1. Train(units pulling)	4. Car(s) (moving)	7. Light(s) (standing)	
B. Truck	E. Van	H. Motorcycle	M. Other (spec. in narrative)	2. Train(units pushing)	5. Car(s) (standing)	8. Other (specify in narrative)	N/A
108. Vehicle Speed (est. MPH at impact)	N/A	109. geographical	Code	112. Position of Car Unit in	N/A		
		1. North 2. South 3. East 4. West	N/A				

110. Position 1. Stalled on Crossing 2. Stopped on Crossing 3. Moving Over Crossing 4. Trapped				Code N/A	113. Circumstance 1. Rail Equipment Struck Highway User 2. Rail Equipment Struck by Highway User				Code N/A		
114a. Was the highway user and/or rail equipment involved in the impact transporting hazardous materials? 1. Highway User 2. Rail Equipment 3. Both 4. Neither				Code N/A	114b. Was there a hazardous materials release 1. Highway User 2. Rail Equipment 3. Both 4. Neither				Code N/A		
114c. State here the name and quantity of the hazardous materials released, if any. N/A											
115. Type Crossing 1. Gates 2. Cantilever FLS 3. Standard FLS Warning 4. Wig Wags 5. Hwy. traffic signals 6. Audible				Code N/A	116. Signaled Crossing (See instructions for codes)				Code N/A	117. Whistle Ban 1. Yes 2. No 3. Unknown	
Code(s)				N/A	N/A	N/A	N/A	N/A	N/A	N/A	
118. Location of Warning 1. Both Sides 2. Side of Vehicle Approach 3. Opposite Side of Vehicle Approach				Code N/A	119. Crossing Warning with Highway Signals 1. Yes 2. No 3. Unknown				Code N/A	120. Crossing Illuminated by Street Lights or Special Lights 1. Yes 2. No 3. Unknown	
121. Age N/A		122. Driver's Gender 1. Male 2. Female		Code N/A	123. Driver Drove Behind or in Front of and Struck or was Struck by Second Train 1. Yes 2. No 3. Unknown				Code N/A	124. Driver 1. Drove around or thru the Gate 2. Stopped and then Proceeded 3. Did not Stop	
125. Driver Passed Highway Vehicle 1. Yes 2. No 3. Unknown				Code N/A	126. View of Track Obscured by (primary obstruction) 1. Permanent Structure 2. Standing Railroad Equipment 3. Passing Train 4. Topography 5. Vegetation 6. Highway Vehicle 7. Other (specify in narrative) 8. Not obstructed				Code N/A		
Casualties to:			Killed	Injured	127. Driver 1. Killed 2. Injured 3. Uninjured				Code N/A	128. Was Driver in the Vehicle? 1. Yes 2. No	
129. Highway-Rail Crossing Users			N/A	N/A	130. Highway Vehicle Property Damage (est. dollar damage)				N/A	131. Total Number of Highway-Rail Crossing Users (include driver)	
132. Locomotive Auxiliary Lights? 1. Yes 2. No				Code N/A	133. Locomotive Auxiliary Lights Operational? 1. Yes 2. No				Code N/A		
134. Locomotive Headlight Illuminated? 1. Yes 2. No				Code N/A	135. Locomotive Audible Warning Sounded? 1. Yes 2. No				Code N/A		

136. DRAW A SKETCH OF ACCIDENT AREA INCLUDING ALL TRACKS, SIGNALS, SWITCHES, STRUCTURES, OBJECTS, ETC., INVOLVED.

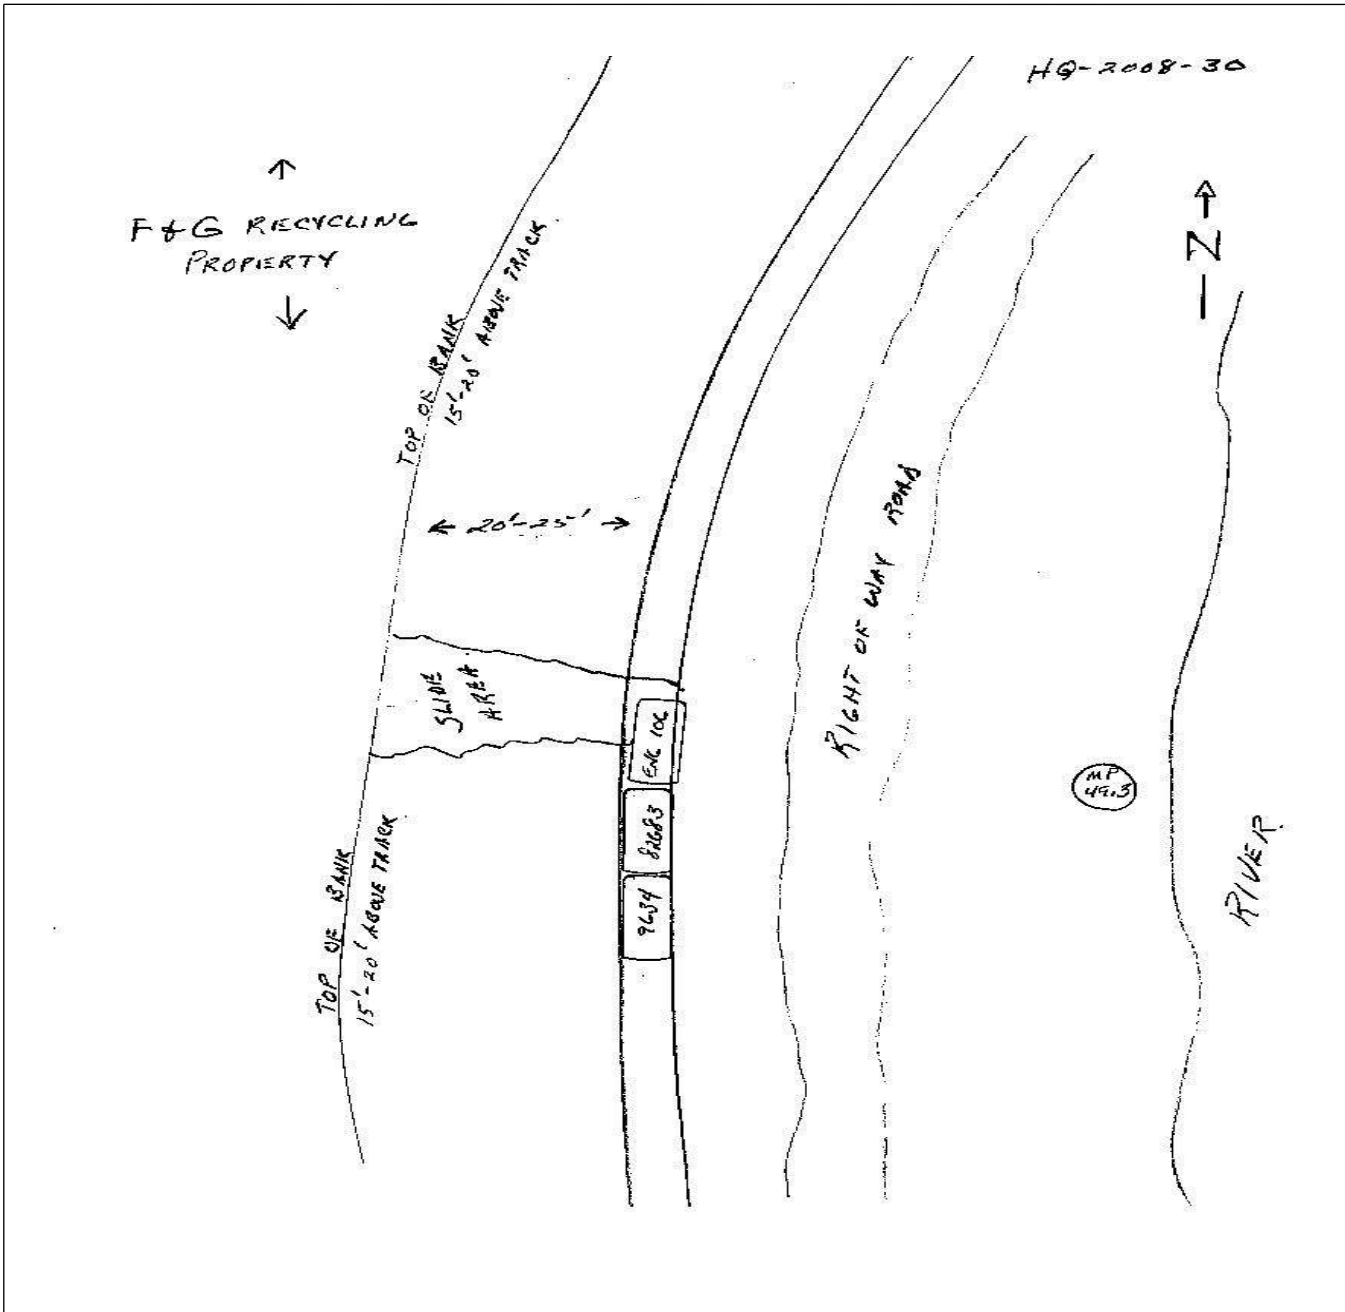

137. SYNOPSIS OF THE ACCIDENT

On March 17, 2008, at approximately 9:56 a.m. EST Amtrak (ATK) Passenger Train # 490 operating northbound on the Amtrak Springfield Line at milepost 49.3 north of Windsor Locks, CT in Hartford County derailed locomotive # AMT 106. The engineer of northbound ATK Train # 490 approached the area and slowed for a speed restriction of 30 mph beginning at milepost 49.3. He observed tree branches covering the track ahead and as he got closer, he noticed a mud slide with large trees on the track. The engineer put the train into emergency and told the Conductor to brace himself for impact. The locomotive hit the mudslide and derailed upright to the east side in line with the track.

The engineer made an emergency call to the Springfield Line Dispatcher and reported that they had hit a mudslide and derailed the locomotive. The engineer checked with the conductor and he reported no injuries to any passengers or crewmembers.

The Engineer stated that while traveling southbound earlier in the morning he did not notice anything out of the ordinary within the milepost 49.3 area.

There was approximately \$ 47,021.00 damage to the equipment.

The weather was clear and 40 degrees F.

The probable cause of the derailment was a mudslide on the track.

138. NARRATIVE

CIRCUMSTANCES PRIOR TO THE ACCIDENT

After completing the required statutory off duty rest period of 12 hours, the Engineer and crew went on duty at Springfield, MA at 4:55 a.m. on March 17, 2008 and proceeded to collect all the necessary paperwork and conducted a job briefing. Their normal tour of duty is from Springfield, MA as Amtrak Train # 141 to New Haven, CT and return on ATK Train # 490.

They then called the Springfield Line Dispatcher and reported crew names and on duty times and then inspected ATK locomotive # 105 and the remainder of ATK Train # 141 and conducted an air brake test and updated their job briefing.

They departed Springfield at 5:35 a.m. with ATK Train # 141 and proceeded southbound to New Haven, CT and reportedly experienced an uneventful trip. The engineer stated that while traveling south through the area of milepost 49.3, he did not observe anything out of the ordinary.

They arrived in New Haven at 7:28 a.m. and switched trains and departed at 8:38 a.m. on ATK Train # 490 with ATK locomotive # 106, ATK Coach Car # 82638 and ATK Control Car # 9634. The northbound trip was uneventful to the Windsor Locks, CT Amtrak station.

THE ACCIDENT

After departing the Windsor Locks Train Station at 9:51 a.m. northbound at the authorized timetable speed of 80 mph, the engineer was slowing down for a temporary speed restriction of 30 mph at milepost 49.3, when he noticed branches covering the track ahead and as approached he noticed the mudslide covering the tracks.

He immediately put the train into emergency and told the conductor to brace himself for the impending impact and then collided with the mudslide. After coming to a stop at approximately 9:58 a.m. the engineer made an emergency call by radio to the Springfield Line dispatcher and reported his train had hit a mudslide at

milepost 49.3 and had derailed the locomotive. He then left the locomotive and checked with the conductor and was told there were no reported injuries to the crew or 6 passengers that were on board.

ANALYSIS

The F & G Recycling facility is located on the west side of the track in the vicinity of milepost 49.3. Over an extended period of time an earth berm has been constructed about 15 to 20 feet above the track level and approximately 20 to 25 feet from the track to the west. This bank runs parallel to the track for about a quarter of a mile in this area.

After speaking to several Amtrak employees at the scene, they indicated that F & G Recycling has been piling snow on the top of this bank at this location all winter which most likely allowed the bank to become saturated by the snow melt and the recent heavy rains and for unknown reasons gave way.

This track is required to be inspected twice weekly per Rule 49 CFR Part 213.233 because of passenger train operations and class of track (FRA Class 4). The track was last inspected on Thursday, March 13, 2008 and was to be inspected behind ATK Passenger Train # 490 on the day of the derailment.

CONCLUSION:

There was no way for the engineer to know there was a problem ahead of his train since the mudslide did not disturb the track bed to the extent of a signal interruption indication and that he had not noticed anything out of the ordinary in this area earlier in the day.

PROBABLE CAUSE AND CONTRIBUTING FACTORS:

This bank location apparently became saturated by the piles of snow and the recent heavy rains and allowed the bank to become saturated and unstable. The cause of the derailment was a mudslide on the track.